

# ALGORITHM THEORETICAL BASIS DOCUMENT (ATBD) -NET RADIOMETER

PREPARED BY	ORGANIZATION	DATE
Derek Smith	FIU	07/02/2013
Josh Roberti	FIU	09/22/2015
Natchaya Pingintha-Durden	FIU	01/09/2015
Jesse Vance	AQU	02/08/2015

APPROVALS	ORGANIZATION	APPROVAL DATE
Andrea Thorpe	SCI	10/23/2015
Dave Tazik	SCI	10/13/2015
Hanne Buur	PSE	10/20/2015

RELEASED BY	ORGANIZATION	RELEASE DATE
Jennifer DeNicholas	СМ	10/23/2015

See configuration management system for approval history.

© 2015 NEON Inc. All rights reserved.

The National Ecological Observatory Network is a project solely funded by the National Science Foundation and managed under cooperative agreement by NEON, Inc. Any opinions, findings, and conclusions or recommendations expressed in this material are those of the author(s) and do not necessarily reflect the views of the National Science Foundation.



## Change Record

REVISION	DATE	ECO #	DESCRIPTION OF CHANGE
А	08/28/2013	ECO-00922	Initial Release
В	10/23/2015	ECO-03110	Updated document to reflect L0 and L1 data product renumbering Revised Algorithm Implementation and Uncertainty Sections Added aquatic meteorology station information. implemented standardized coverage factor of k=2 Moved consistency analyses outline to Future Plans / Modifications Sections



## TABLE OF CONTENTS

1	DI	ESCRIF	PTION
	1.1	Purp	ose1
	1.2	Scop	ne1
2	RE	ELATEI	D DOCUMENTS, ACRONYMS AND VARIABLE NOMENCLATURE
	2.1	Appl	icable Documents
	2.2	Refe	rence Documents
	2.3	Acro	nyms3
	2.4	Varia	able Nomenclature
	2.5	Verb	Convention4
3	D	ATA PI	RODUCT DESCRIPTION
	3.1	Varia	ables Reported4
	3.2	Inpu	t Dependencies
	3.3	Prod	uct Instances5
	3.4	Tem	poral Resolution and Extent5
	3.5	Spat	ial Resolution and Extent5
4	SC	CIENTI	FIC CONTEXT
	4.1	Theo	bry of Measurement
	4.2	Theo	pry of Algorithm7
5	Al	lgori	THM IMPLEMENTATION9
6	U	NCERT	TAINTY
	6.1	Unce	ertainty of Radiation Measurements12
	6.	1.1	Measurement Uncertainty13
	6.	1.2	Uncertainty of L1 Mean Data Product17
	6.2	Unce	ertainty Budget21
7	FL	JTURE	PLANS AND MODIFICATIONS
8	BI	BLIOG	SRAPHY



#### LIST OF TABLES AND FIGURES

Table 3-1: List of net radiometer-related L0 DPs that are transformed into L1 DPs via this ATBD
Table 5-1: Flags associated with radiation measurements11
Table 5-2: Information maintained in the CI data store for the net radiometer11
Table 6-1: Uncertainty budget for individual radiation measurements. Shaded rows denote the order ofuncertainty propagation (from lightest to darkest)
Table 6-2: Uncertainty budget for L1 mean radiation DPs. Shaded rows denote the order of uncertaintypropagation (from lightest to darkest).22

Figure 1: Displays the data flow and associated uncertainties of individual radiation measurements and
L1 radiation DPs. For more information regarding the methods by which the net radiometer is
calibrated, please refer to AD[08,12,13]12



## 1 DESCRIPTION

Contained in this document are details concerning net radiation measurements made at all NEON sites. Incoming and outgoing long wave (LW) and short wave (SW) radiation will be measured via the net radiometer discussed here. Specifically, the algorithm process necessary to convert "raw" sensor measurements into meaningful scientific units and their associated uncertainties are described.

#### 1.1 Purpose

This document details the algorithms used for creating NEON Level 1 data product from Level 0 data, and ancillary data as defined in this document (such as calibration data), obtained via instrumental measurements made by the net radiometer. It includes a detailed discussion of measurement theory and implementation, appropriate theoretical background, data product provenance, quality assurance and control methods used, approximations and/or assumptions made, and a detailed exposition of uncertainty resulting in a cumulative reported uncertainty for this product.

## 1.2 Scope

The theoretical background and entire algorithmic process used to derive Level 1 data from Level 0 data for the net radiometer are described in this document. It is expected that the net radiometer employed at all NEON tower sites is the Hukseflux NR01 (NEON part number: 0300070002). This document does not provide computational implementation details, except for cases where these stem directly from algorithmic choices explained here.



## 2 RELATED DOCUMENTS, ACRONYMS AND VARIABLE NOMENCLATURE

#### 2.1 Applicable Documents

AD[01]	NEON.DOC.000001	NEON Observatory Design
AD[02]	NEON.DOC.005003	NEON Scientific Data Products Catalog
AD[03]	NEON.DOC.002652	NEON Level 1-3 Data Products Catalog
AD[04]	NEON.DOC.005005	NEON Level 0 Data Products Catalog
AD[05]	NEON.DOC.000782	NEON ATBD QA/QC data consistency
AD[06]	NEON.DOC.011081	ATBD QA/QC plausibility tests
AD[07]	NEON.DOC.000783 Products	ATBD QA/QC Time Series Signal Despiking for TIS Level 1 Data
AD[08]	NEON.DOC.000802	NR01 – Net Radiometer Calibration/Validation Procedure
AD[09]	NEON.DOC.000849	C <sup>3</sup> Net Radiometer
AD[10]	NEON.DOC.000927	NEON Calibration and Sensor Uncertainty Values <sup>1</sup>
AD[11]	NEON.DOC.000785	TIS Level 1 Data Products Uncertainty Budget Estimation Plan
AD[12]	NEON.DOC.000751	CVAL Transfer of standard procedure
AD[13]	NEON.DOC.000746	Evaluating Uncertainty (CVAL)
AD[14]	NEON.DOC.002002	Engineering Master Location Sensor Matrix
AD[15]	NEON.DOC.001113	Quality Flags and Quality Metrics for TIS Data Products
AD[16]	NEON.DOC.001452	C <sup>3</sup> AQU Net Radiometer

<sup>&</sup>lt;sup>1</sup> Note that CI obtains calibration and sensor values directly from an XML file maintained and updated by CVAL in real time. This report is updated approximately quarterly such that there may be a lag time between the XML and report updates.



## 2.2 Reference Documents

RD[01]	NEON.DOC.000008	NEON Acronym List
RD[02]	NEON.DOC.000243	NEON Glossary of Terms

#### 2.3 Acronyms

Acronym	Explanation
ATBD	Algorithm Theoretical Basis Document
CVAL	NEON Calibration, Validation, and Audit Laboratory
DAS	Data Acquisition System
DP	Data Product
LO	Level 0
L1	Level 1
PRT	Platinum Resistance Thermometer
UQ	Unquantifiable Uncertainty

#### 2.4 Variable Nomenclature

The symbols used to display the various inputs in the ATBD, e.g., calibration coefficients and uncertainty estimates, were chosen so that the equations can be easily interpreted by the reader. However, the symbols provided will not always reflect NEON's internal notation, which is relevant for Cyberinfrastructure's (Cl's) use, and or the notation that is used to present variables on NEON's data portal. Therefore a lookup table is provided in order to distinguish what symbols specific variables can be tied to in the following document.

Symbol	Internal	Description
	Notation	
$\alpha_{u0}$	CVALA0	CVAL upward facing pyrgeometer sensor sensitivity coefficient
$\alpha_{u1}$	CVALA1	CVAL upward facing pyrgeometer sensor sensitivity coefficient
$\alpha_{u2}$	CVALA2	CVAL upward facing pyrgeometer sensor sensitivity coefficient
$\alpha_{d0}$	CVALA0	CVAL downward facing pyrgeometer sensor sensitivity coefficient
$\alpha_{d1}$	CVALA1	CVAL downward facing pyrgeometer sensor sensitivity coefficient

© 2015 NEON Inc. All rights reserved.



$\alpha_{d2}$	CVALA2	CVAL downward facing pyrgeometer sensor sensitivity coefficient
$\beta_u$	CVALA1	CVAL upward facing pyranometer sensor sensitivity coefficient
$\beta_d$	CVALA1	CVAL downward facing pyranometer sensor sensitivity coefficient
$O_R$	U_CVALR4	offset imposed by the FDAS for resistance readings ( $\Omega$ )
<i>O<sub>V</sub></i>	U_CVALV4	offset imposed by the FDAS for voltage readings (V)
u <sub>A1,Pu</sub>	U_CVALA1	Combined, relative calibration uncertainty of incoming shortwave radiation (%)
$u_{A1,Pd}$	U_CVALA1	Combined, relative calibration uncertainty of outgoing shortwave radiation (%)
u <sub>A1,Uu</sub>	U_CVALA1	Combined, standard calibration uncertainty of incoming longwave radiation (W m <sup>-2</sup> )
u <sub>A1,Ud</sub>	U_CVALA1	Combined, standard calibration uncertainty of outgoing longwave radiation (W m <sup>-2</sup> )
u <sub>A3,Pu</sub>	U_CVALA3	Combined, relative calibration uncertainty (truth and trueness) of incoming shortwave radiation (%)
u <sub>A3,Pd</sub>	U_CVALA3	Combined, relative calibration uncertainty (truth and trueness) of outgoing shortwave radiation (%)
u <sub>A3,Uu</sub>	U_CVALA3	Combined, standard calibration uncertainty (truth and trueness) of incoming longwave radiation (W m <sup>-2</sup> )
u <sub>A3,Ud</sub>	U_CVALA3	Combined, standard calibration uncertainty (truth and trueness) of outgoing longwave radiation (W m <sup>-2</sup> )
<i>u</i> <sub><i>R</i>1</sub>	U_CVALR1	Combined, relative uncertainty of Field DAS resistance readings (%)
<i>u</i> <sub>R3</sub>	U_CVALR3	Combined, relative uncertainty (truth and trueness only) of Field DAS resistance readings (%)
$u_{V1}$	U_CVALV1	Combined, relative uncertainty of Field DAS voltage readings (%)
$u_{V3}$	U_CVALV3	Combined, relative uncertainty (truth and trueness only) of Field DAS voltage readings (%)

## 2.5 Verb Convention

"Shall" is used whenever a specification expresses a provision that is binding. The verbs "should" and "may" express non-mandatory provisions. "Will" is used to express a declaration of purpose on the part of the design activity.

## **3** DATA PRODUCT DESCRIPTION

## 3.1 Variables Reported



Net radiometer-related L1 DPs provided by the algorithms documented in this ATBD are displayed in the accompanying file nrd\_datapub\_NEONDOC002857.txt.

## 3.2 Input Dependencies

Table 3-1 details the net radiometer-related LO DPs used to produce L1 DPs via this ATBD.

Description	Sample	Units	Data Product Number
	Frequency		
Upward facing	1 Hz	V	NEON.DOM.SITE.DP0.00023.001.01315.HOR.VER.000
pyranometer (P <sub>u</sub> )			
Downward facing	1 Hz	V	NEON.DOM.SITE.DP0.00023.001.01316.HOR.VER.000
pyranometer (P <sub>d</sub> )			
Upward facing	1 Hz	V	NEON.DOM.SITE.DP0.00023.001.01317.HOR.VER.000
pyrgeometer (U <sub>u</sub> )			
Downward facing	1 Hz	V	NEON.DOM.SITE.DP0.00023.001.01318.HOR.VER.000
pyrgeometer ( <i>U<sub>d</sub></i> )			
Sensor body PRT	1 Hz	Ω	NEON.DOM.SITE.DP0.00023.001.01314.HOR.VER.000
resistance at			
temperature $T(R_t)$			
Heater Flag ( <i>QF_H</i> )	1 Hz	NA	NEON.DOM.SITE.DP0.00023.001.01319.HOR.VER.000

## Table 3-1: List of net radiometer-related L0 DPs that are transformed into L1 DPs via this ATBD.

## 3.3 Product Instances

A Hukseflux NR01 will be deployed on all core and re-locatable towers and aquatic met stations. Additionally, a Hukseflux NR01 will be deployed in the central most plot of the soil array at all tower sites, which will measure *only* incoming and outgoing LW radiation at the soil surface.

#### 3.4 Temporal Resolution and Extent

One- and thirty-minute averages of SW and LW radiation will be calculated to form L1 DPs.

#### 3.5 Spatial Resolution and Extent

Net radiometers will be deployed at the top level of the tower infrastructure and the central most plot of the soil array at all core and re-locatable tower sites. Net radiometers will be deployed at a standard height of 3 m above ground level at all aquatic sites. In addition, net radiometers will be deployed on the buoys at lake sites. Thus, NR01 measurements will represent the point in space where the measurement is taken. See AD[14] for site specific sensor location details.

> © 2015 NEON Inc. All rights reserved. Page 5 of 23



## 4 SCIENTIFIC CONTEXT

The sun's energy is emitted to the earth mainly in the form of incoming short-wave (SW) radiation, with a small portion of it falling into incoming LW radiation wavelengths. Approximately 50% of the sun's emitted energy lies in the infrared wavelengths, between 0.7 and 5  $\mu$ m. Of the remaining radiant energy from the sun, around 40% can be found in the visible region (i.e., 0.4-0.7  $\mu$ m) and 10% in the ultraviolet region (i.e. <0.4  $\mu$ m) (Fu, 2003; Goody and Yung, 1995).

A fraction of incoming solar radiation is returned to space through either reflection or backscattering, which is known as albedo. The earth's albedo is presently around 31% (Fu, 2003). Thus, the bulk of the sun's radiation is absorbed by the earth's surface. A portion of the radiation absorbed by the earth is then re-emitted back into the atmosphere in the form of LW radiation. This re-emitted LW radiation can be absorbed by gases in the atmosphere and re-radiated back to the earth's surface. This re-radiation of LW radiation results in atmospheric warming, known as the greenhouse effect. As such, incoming and outgoing SW and LW radiation are principal drivers of the hydrologic and energy budgets. Thus, time-series studies of net radiation are of great interest to the scientific and broader community to understand rates of change and their potential implications.

## 4.1 Theory of Measurement

The Hukseflux NR01 is a passive net radiation sensor, which serves to measure four separate components of surface radiation. The radiometer uses thermopiles to determine SW and LW fluxes from small output voltages that are proportional to the incoming and outgoing SW and LW fluxes. The net radiometer consists of four main components; a pyranometer, pyrgeometer, PRT, and a heater.

The pyranometer is used to measure SW radiation flux ( $300 < \lambda < 2800$  nm), and is composed of one upward and one downward facing thermopile to measure incoming and outgoing SW radiation. The thermopile in the pyranometer is encased in a glass dome, which limits the spectral response from 300 to 2800 nm and shields the thermopile from atmospheric convection. The pyrgeometer determines LW radiation in the range of 4500 <  $\lambda$  < 50000 nm. One pyrgeometer will face upward and determine incoming LW radiation, while the other pyrgeometer will face the earth's surface and measure outgoing LW radiation. The pyrgeometer's thermopile is enclosed by a silicon window to inhibit radiation below 4500 nm from entering and to shield the thermopile from atmospheric convection.

The pyrgeometer sensor itself emits LW radiation. Thus, the pyrgeometer's thermopile measurements are composed of the incoming minus the sensor outgoing LW radiation. If we consider the sensor to be a black body, we apply the Stefan–Boltzmann law to determine the portion of LW radiation emitted by the sensor. To summarize, the Stefan–Boltzmann law states that radiation emitted by a black body object is directly proportional to the fourth power of the black body's temperature. A PRT housed in the sensor body will determine sensor body temperature. Thus, the PRT will allow the fraction of LW



radiation emitted by the pyrgeometer to be measured. The last component of the net radiometer is a heater, which is used to prevent condensation from developing on the sensor.

## 4.2 Theory of Algorithm

In addition to the thermopile outputs from the upward and downward facing pyranometers and pyrgeometers, sensor specific sensitivities are needed to derive values for SW and LW radiation. The sensor specific sensitivities are determined by CVAL according to AD[08]. As previously mentioned, sensor body temperature is needed to determine incoming and outgoing LW radiation. This is due to the LW radiation that is emitted by the pyrgeometer, and thus the thermopile measurements represent incoming minus the portion of LW radiation that is emitted. Sensor body temperature will be determined from the PRT using two separate equations; one equation for temperatures < 0 °C, Eq. (2), and one for temperatures  $\ge$  0 °C, Eq. (3), (ASTM, 2004). The raw resistance received from the PRT will identify which equation will be used to determine the temperature (*T*) accordingly:

$$T = \begin{vmatrix} \text{Eq.}(2) & \text{if } (\text{R}_{t} < 100 \ \Omega) \\ \text{Eq.}(3) & \text{if } (\text{R}_{t} \ge 100 \ \Omega) \end{vmatrix}$$
(1)

The non-linearity of a PRT can be expressed as follows for resistance < 100 [ $\Omega$ ] as (ASTM, 2004):

$$T_i = \sum_{k=1}^{4} D_k (R_{t_i}/R_0 - 1)^k$$
(2)

Where,

$T_i$	= Individual (1 Hz) Temperature (°C)
$R_{t_i}$	= Individual PRT resistance at temperature, $T(\Omega)$
$R_0$	= 100 ( $\Omega$ ) [Nominal resistance at 0 °C defined as 100 $\Omega$ for a PRT 100]
$D_1$	= 255.819 (°C) [coefficient defined by ASTM – E 1137/E 1137M]
$D_2$	= 9.14550 (°C) [coefficient defined by ASTM – E 1137/E 1137M]
$D_3$	= -2.92363 (°C) [coefficient defined by ASTM – E 1137/E 1137M]
$D_4$	= 1.79090 (°C) [coefficient defined by ASTM – E 1137/E 1137M]

Likewise, for resistance  $\geq$  100 [ $\Omega$ ] ASTM (2004) expresses PRTs' non-linearity as:

$$T_{i} = \frac{\left(A^{2} - 4B\left(1 - R_{t_{i}}/R_{0}\right)\right)^{\frac{1}{2}} - A}{2B}$$
(3)

Where,

 $T_i$  = Individual (1 Hz) Temperature (°C)



$R_{t_i}$	= Individual PRT resistance at temperature, $T(\Omega)$
$R_0$	= 100 ( $\Omega$ ) [Nominal resistance at 0°C defined as 100 $\Omega$ for a PRT 100]
Α	= 3.9083*10 <sup>-3</sup> (°C <sup>-1</sup> ) [coefficient defined by IEC 751 and the ITS-90 scale]
В	= -5.775*10 <sup>-7</sup> (°C <sup>-2</sup> ) [coefficient defined by IEC 751 and the ITS-90 scale]

Note: In the event that the International Temperature Scale (ITS) is updated from the ITS-90 scale, the coefficients listed above will be revised to reflect the most current ITS.

It is then necessary to convert temperature from Celsius to Kelvin as follows:

$$T(K) = T(^{\circ}C) + 273.15 \text{ K}$$
 (4)

Once sensor body temperature is resolved, individual, incoming and outgoing LW radiation is determined accordingly (NREL 2013):

$$L_{I_{i}} = \alpha_{u0} + \alpha_{u1}U_{u_{i}} + \alpha_{u2}\sigma_{SB}(T_{i} + cU_{u_{i}})^{4}$$
(5)

And

$$L_{O_{i}} = \alpha_{d0} + \alpha_{d1} U_{d_{i}} + \alpha_{d2} \sigma_{SB} (T_{i} + c U_{d_{i}})^{4}$$
(6)

Where,

$\begin{array}{ll} L_{O_{i}} & = \text{Individual Outgoing Long Wave Radiation [W m^{-2}]} \\ U_{u_{i}} & = \text{Individual upward- facing pyrgeometer [V]} \\ U_{d_{i}} & = \text{Individual downward- facing pyrgeometer [V]} \\ \alpha_{u0} & = \text{Upward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL} \\ \alpha_{u1} & = \text{Upward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] provided by CVAL} \\ \alpha_{u2} & = \text{Upward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d0} & = \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL} \\ \alpha_{d1} & = \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \sigma_{SB} & = 5.67*10^{-8} [\text{Stefan-Boltzmann constant, W m^{-2} K^{-4}] \\ T_{i} & = \text{Sensor body temperature [K]} \\ c & = 704.4 [K V^{-1}] \end{array}$	$L_{I_i}$	= Individual (1 Hz) Incoming Long Wave Radiation [W m <sup>-2</sup> ]
$\begin{array}{ll} U_{d_{i}} &= \mbox{Individual downward-facing pyrgeometer [V]} \\ a_{u0} &= \mbox{Upward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL \\ a_{u1} &= \mbox{Upward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] provided by CVAL \\ a_{u2} &= \mbox{Upward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL \\ a_{d0} &= \mbox{Downward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL \\ a_{d1} &= \mbox{Downward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL \\ a_{d2} &= \mbox{Downward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] provided by CVAL \\ a_{d2} &= \mbox{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL \\ a_{d2} &= \mbox{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL \\ a_{5B} &= 5.67*10^{-8} [\mbox{Stefan-Boltzmann constant, W m^{-2} K^{-4}] \\ T_{i} &= \mbox{Sensor body temperature [K]} \end{array}$	$L_{O_i}$	= Individual Outgoing Long Wave Radiation [W m <sup>-2</sup> ]
$\begin{array}{ll} \alpha_{u0} &= \text{Upward facing pyrgeometer sensor sensitivity } [\text{W m}^{-2}] \text{ provided by CVAL} \\ \alpha_{u1} &= \text{Upward facing pyrgeometer sensor sensitivity } [\text{W m}^{-2} \text{V}^{-1}] \text{ provided by CVAL} \\ \alpha_{u2} &= \text{Upward facing pyrgeometer sensor sensitivity } [\text{unitless}] \text{ provided by CVAL} \\ \alpha_{d0} &= \text{Downward facing pyrgeometer sensor sensitivity } [\text{W m}^{-2}] \text{ provided by CVAL} \\ \alpha_{d1} &= \text{Downward facing pyrgeometer sensor sensitivity } [\text{W m}^{-2} \text{V}^{-1}] \text{ provided by CVAL} \\ \alpha_{d2} &= \text{Downward facing pyrgeometer sensor sensitivity } [\text{W m}^{-2} \text{V}^{-1}] \text{ provided by CVAL} \\ \alpha_{d2} &= \text{Downward facing pyrgeometer sensor sensitivity } [\text{unitless}] \text{ provided by CVAL} \\ \alpha_{5B} &= 5.67*10^{-8} \text{ [Stefan-Boltzmann constant, W m}^{-2} \text{K}^{-4}] \\ T_i &= \text{Sensor body temperature } [\text{K}] \end{array}$	$U_{u_i}$	= Individual upward- facing pyrgeometer [V]
$\begin{array}{ll} \alpha_{u1} &= \text{Upward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] \text{ provided by CVAL} \\ \alpha_{u2} &= \text{Upward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d0} &= \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2}] \text{ provided by CVAL} \\ \alpha_{d1} &= \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] \text{ provided by CVAL} \\ \alpha_{d2} &= \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d2} &= \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{5B} &= 5.67*10^{-8} [\text{Stefan-Boltzmann constant, W m}^{-2} \text{K}^{-4}] \\ T_i &= \text{Sensor body temperature [K]} \end{array}$	$U_{d_i}$	= Individual downward- facing pyrgeometer [V]
$\begin{aligned} \alpha_{u2} &= \text{Upward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{d0} &= \text{Downward facing pyrgeometer sensor sensitivity [W m-2] provided by CVAL} \\ \alpha_{d1} &= \text{Downward facing pyrgeometer sensor sensitivity [W m-2 V-1] provided by CVAL} \\ \alpha_{d2} &= \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \alpha_{SB} &= 5.67*10^{-8} \text{ [Stefan-Boltzmann constant, W m-2 K-4]} \\ T_i &= \text{Sensor body temperature [K]} \end{aligned}$	$\alpha_{u0}$	
$\begin{array}{l} \alpha_{d0} & = \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2}] provided by CVAL} \\ \alpha_{d1} & = \text{Downward facing pyrgeometer sensor sensitivity [W m^{-2} V^{-1}] provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \sigma_{SB} & = 5.67*10^{-8} [\text{Stefan-Boltzmann constant, W m}^{-2} \text{K}^{-4}] \\ T_i & = \text{Sensor body temperature [K]} \end{array}$	$\alpha_{u1}$	= Upward facing pyrgeometer sensor sensitivity [W m <sup>-2</sup> V <sup>-1</sup> ] provided by CVAL
$\begin{array}{l} \alpha_{d1} & = \text{Downward facing pyrgeometer sensor sensitivity } [W \text{ m}^{-2} \text{ V}^{-1}] \text{ provided by CVAL} \\ \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \sigma_{SB} & = 5.67*10^{-8} \text{ [Stefan-Boltzmann constant, W m}^{-2} \text{ K}^{-4}] \\ T_i & = \text{Sensor body temperature } [\text{K}] \end{array}$	$\alpha_{u2}$	= Upward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL
$\begin{array}{l} \alpha_{d2} & = \text{Downward facing pyrgeometer sensor sensitivity [unitless] provided by CVAL} \\ \sigma_{SB} & = 5.67*10^{-8} \left[\text{Stefan-Boltzmann constant, W m}^{-2} \text{K}^{-4}\right] \\ T_i & = \text{Sensor body temperature [K]} \end{array}$	$\alpha_{d0}$	
$\sigma_{SB} = 5.67*10^{-8} [Stefan-Boltzmann constant, W m^{-2} K^{-4}]$ $T_i = Sensor body temperature [K]$	$\alpha_{d1}$	= Downward facing pyrgeometer sensor sensitivity [W m <sup>-2</sup> V <sup>-1</sup> ] provided by CVAL
$T_i$ = Sensor body temperature [K]	$\alpha_{d2}$	
	$\sigma_{SB}$	= 5.67*10 <sup>-8</sup> [Stefan-Boltzmann constant, W m <sup>-2</sup> K <sup>-4</sup> ]
$c = 704.4 [\text{K V}^{-1}]$	$T_i$	= Sensor body temperature [K]
	С	= 704.4 [K V <sup>-1</sup> ]

Incoming and outgoing SW radiation is determined from the pyranometer as follows:


$$S_{I_i} = P_{u_i} \beta_u \tag{7}$$

And,

$$S_{O_i} = P_{d_i} \beta_d \tag{8}$$

 $\odot$  2015 NEON Inc. All rights reserved.

## Page **8** of **23**



Where,

 $S_{Ii}$  = Incoming Short Wave Radiation (W m<sup>-2</sup>)  $S_{Oi}$  = Outgoing Short Wave Radiation (W m<sup>-2</sup>)

 $P_{\mu_i}$  = Upward facing pyranometer (V)

 $P_{d_i}$  = Downward facing pyranometer (V)

 $\beta_u$  = Upward facing pyranometer sensor sensitivity (W m<sup>-2</sup> V<sup>-1</sup>) provided by CVAL

 $\beta_d$  = Downward facing pyranometer sensor sensitivity (W m<sup>-2</sup> V<sup>-1</sup>) provided by CVAL

One-minute and thirty-minute averages will be determined accordingly to create L1 DPs listed in file nrd\_datapub\_NEONDOC002857.txt. Here we let *Rad* represent incoming and outgoing LW and SW radiation since they will be averaged the same way:

$$\overline{Rad}_1 = \frac{1}{n} \sum_{i=1}^n Rad_i \tag{9}$$

where, for each 1-minute average, n is the number of measurements during the averaging period and  $Rad_i$  is a 1-Hz radiation measurement taken during the 60-second averaging period [0, 60). For a 1-minute average, n = 60 if all data points are included.

and

$$\overline{Rad}_{30} = \frac{1}{n} \sum_{i=1}^{n} Rad_i$$
(10)


where, for each 30-minute average, n is the number of measurements during the averaging period and  $Rad_i$  is a 1-Hz temperature measurement taken during the 1800-second averaging period [0, 1800).

Note: The beginning of the first averaging period in a series shall be the nearest whole minute less than or equal to the first timestamp in the series.

#### 5 ALGORITHM IMPLEMENTATION

Data flow for signal processing of L1 DPs will be treated in the following order.

- 1. The net radiometer LO DPs will be converted into incoming and outgoing SW and LW radiation through Eq. (1)-(8).
- 2. QA/QC Plausibility tests will be applied to the data stream in accordance with AD[06], details are provided below.
- 3. Signal de-spiking will be applied to the data stream in accordance with AD[07].



- 4. One- and thirty-minute SW and LW radiation averages will be calculated using Eq. (9) and (10) and descriptive statistics, i.e. minimum, maximum, and variance, will be determined for averaging periods.
- 5. Quality metrics, quality flags, and the final quality flag will be produced for one- and thirtyminute averages according to AD[15].

## QA/QC Procedure:

Plausibility Tests AD[08] – All plausibility tests will be determined for the net radiometer. Test
parameters will be provided by FIU and maintained in the CI data store. All plausibility tests will
be applied to the sensor's converted L0 DPs and an associated quality flags (QFs) will be
generated for each test.

$$\overline{Rad}_{30} = \frac{1}{n} \sum_{i=x}^{n} Rad_i$$
(11)

- 2. Sensor Test A heater flag as identified in the C<sup>3</sup> document (AD[09]) will be applied to L0 DPs while the heater is operational. It is assumed that any heater-induced temperature changes in the sensor will be in equilibrium with the PRT. Therefore, any measurement variability induced by the heater, while it is on, will be accounted for by the internal PRT. One- and thirty-minute averages of quality metrics of the heater flag will be produced according to AD[15]. This offers a user greater transparency, as one will be able to identify the number of L0 DPs where the heater was on that went into creating the L1 DP.
- 3. **Signal De-spiking** Time segments and threshold values for the automated de-spiking QA/QC routine will be specified by FIU and maintained in the CI data store. Flags from the de-spiking analysis will be applied according to AD[07].
- 4. Quality Flags (QFs) and Quality Metrics (QMs) AD[15] If a datum has failed one of the following tests it will not be used to create a L1 DP,*range*and*de-spiking* $. <math>\alpha$  and  $\beta$  QFs and QMs will be determined using the flags listed in Table 5-1 with the exception of the heat flag. In addition, L1 DPs will have a QA/QC report and quality metrics associated with each flag listed in Table 5-1 as well as a final quality flag (*finalQF*), as detailed in AD[15]. Ancillary information needed for the algorithm and other information maintained in the CI data store is shown in Table 5-2.



#### Table 5-1: Flags associated with radiation measurements.

Flags
Range
Persistence
Step
Null
Gap
Signal De-spiking
Alpha
Beta
Final Quality Flag
Heater Flag

#### Table 5-2: Information maintained in the CI data store for the net radiometer.

Tests/Values	CI Data Store Contents		
Range	Minimum and maximum values		
Persistence	Window size, threshold values and		
	maximum time length		
Step	Threshold values		
Null	Test limit		
Gap	Test limit		
Signal Despiking	Time segments and threshold values		
Calibration	CVAL sensor specific calibration		
	coefficients AD[08]		
Uncertainty	AD[10]		
Sensor Test	AD[09]		
Final Quality Flag	AD[15]		

#### 6 UNCERTAINTY

Uncertainty of measurement is inevitable; therefore, measurements should be accompanied by a statement of their uncertainty for completeness (JCGM 2008; Taylor 1997). To do so, it is imperative to identify all sources of measurement uncertainty related to the quantity being measured. Quantifying the uncertainty of TIS measurements will provide a measure of the reliability and applicability of individual measurements and TIS data products. This portion of the document serves to identify, evaluate, and quantify sources of uncertainty relating to individual, calibrated radiation measurements



as well as L1 mean radiation data products. It is a reflection of the information described in AD[12], and is explicitly described for the radiation assembly in the following sections.

## 6.1 Uncertainty of Radiation Measurements

Uncertainty of the net radiometer assembly is discussed in this section. Discussion is broken down into two topics informing the discrepancy between the two types of uncertainty presented within this document. The first subsection details the sources of *measurement* uncertainty, i.e., those associated with *individual measurements*. The second discusses uncertainties associated with temporally averaged data products. A diagram detailing the data flow and known sources of uncertainty are displayed in Figure 1.

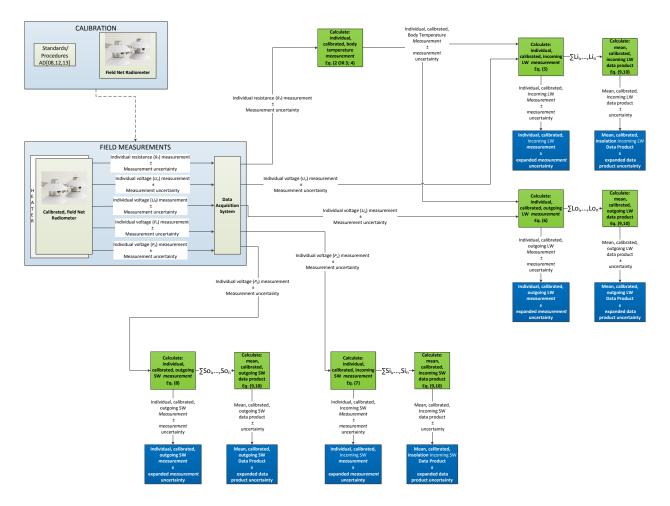


Figure 1: Displays the data flow and associated uncertainties of individual radiation measurements and L1 radiation DPs. For more information regarding the methods by which the net radiometer is calibrated, please refer to AD[08,12,13].

© 2015 NEON Inc. All rights reserved.

Page **12** of **23** 



## 6.1.1 Measurement Uncertainty

The following subsections present the uncertainties associated with *individual observations*. It is important to note that the uncertainties presented in the following subsections are *measurement uncertainties*, that is, they reflect the uncertainty of an *individual* measurement. These uncertainties should not be confused with those presented in Section 6.1.2. We urge the reader to refer to AD[12] for further details concerning the discrepancies between quantification of measurement uncertainties and L1 uncertainties.

NEON calculates measurement uncertainties according to recommendations of the Joint Committee for Guides in Metrology (JCGM) 2008. In essence, if a measurand *y* is a function of *n* input quantities

 $x_i$  (i = 1, ..., n),  $i.e., y = f(x_1, x_2, ..., x_n)$ , the combined measurement uncertainty of y, assuming the inputs are independent, can be calculated as follows:

$$u_{c}(y) = \left(\sum_{i=1}^{N} \left(\frac{\partial f}{\partial x_{i}}\right)^{2} u^{2}(x_{i})\right)^{\frac{1}{2}}$$
(12)

Where,

 $\frac{\partial f}{\partial x_i}$  = partial derivative of y with respect to  $x_i$ 

 $u(x_i)$  = combined standard uncertainty of  $x_i$ .

Thus, the uncertainty of the measurand can be found be summing the input uncertainties in quadrature. The calculation of these input uncertainties is discussed below.

## 6.1.1.1 Calibration

CVAL (AD[10]) provides a combined, relative, measurement uncertainty for *each* shortwave radiation measurement stream, and a combined, standard measurement uncertainty for *each* longwave radiation stream. These uncertainties, i.e.,  $u_{A1,Pu}$ ,  $u_{A1,Pd}$ , (shortwave)  $u_{A1,Uu}$ , and  $u_{A1,Ud}$  (longwave) represent i) the repeatability and reproducibility of the data stream and the lab DAS, and ii) uncertainty of the calibration procedures and coefficients including uncertainty in the standard (truth). Each will be stored in the CI data store. After converting the shortwave radiation uncertainties from (%) to measurement units (W m<sup>-2</sup>), each will be applied to the respective, individual radiation measurements (that is, they do not vary with any specific sensor, DAS component, etc.). A detailed summary of the calibration procedures and corresponding uncertainty estimates can be found in AD [08,12,13].

The combined, standard, measurement uncertainty due to the calibration process is calculated as follows for the shortwave radiation measurement streams:

 $\ensuremath{\mathbb{C}}$  2015 NEON Inc. All rights reserved. Page 13 of 23



(13)

 $u_{CVAL}\left(S_{y_{i}}\right) = u_{A1,Pg} * S_{y_{i}}$ 

Where,

$$\begin{array}{ll} u_{CVAL}\left(S_{y_{i}}\right) &= \text{partial uncertainty of shortwave radiation measurement resulting} \\ &\text{from sensor calibration (W m^{-2})} \\ S_{y} &= \text{Incoming / outgoing (subscript 'y') shortwave (W m^{-2})} \\ P_{g} &= \text{Incoming / outgoing (subscript 'g') shortwave radiation voltage output} \\ & (V) \\ u_{A1,Pg} &= \text{relative uncertainty of respective (incoming / outgoing) shortwave} \\ & \text{radiation stream; provided by CVAL (AD[10])} \end{array}$$

**Note**: Uncertainty values of longwave radiation do not need to be converted, as they are provided in W m<sup>-2</sup>.

Internal body temperature *will not* be calibrated at NEON's CVAL, thus, CVAL will not supply an uncertainty value for this measurement. Please refer to Section 6.1.3 for further justification.

## 6.1.1.2 DAS

The uncertainty introduced by the Field DAS is computed via:

$$u_{FDAS}\left(\mathsf{W}_{g_{i}}\right) = \left(u_{V1} * \mathsf{W}_{g_{i}}\right) + O_{V} \tag{14}$$

And,

$$u_{FDAS}(\mathbf{R}_{T_i}) = (u_{R1} * \mathbf{R}_{T_i}) + O_R$$
(15)

Where,

$$u_{FDAS}(W_{g_i}) = \text{combined, standard uncertainty of the respective voltage stream (W, either shortwave or longwave) introduced by the Field DAS (V)
 $u_{FDAS}(R_{T_i}) = \text{combined, standard uncertainty of the resistance output introduced by the Field DAS (\Omega)}$   
 $W_g = \text{respective voltage output (V)}$   
 $R_T = \text{resistance output } (\Omega)$$$

© 2015 NEON Inc. All rights reserved. Page **14** of **23** 



<i>u</i> <sub><i>V</i>1,</sub>	<ul> <li>combined, relative Field DAS uncertainty for voltage measurements</li> <li>provided by CVAL (unitless)</li> </ul>
<i>u</i> <sub><i>R</i>1</sub>	= combined, relative Field DAS uncertainty for resistance measurements provided by CVAL (unitless)
$O_V$	= offset (voltage) imposed by the FDAS provided by CVAL (V)
$O_R$	= offset (resistance) imposed by the FDAS provided by CVAL ( $\Omega$ )

To calculate the partial uncertainty of individual *longwave* radiation measurements resulting from DAS noise, standard DAS uncertainties must be multiplied by the absolute value of Eq. (5)'s (incoming) or (6)'s (outgoing) partial derivative with respect to the raw voltage measurement:

$$\frac{\partial L_{Y_i}}{\partial U_{Y_i}} = \alpha_1 + 4c\alpha_2\sigma_{SB} (T_i + cU_{Y_i})^3$$
(16)

$$u_{FDAS_{U_{g_i}}}(L_{Y_i}) = \left| \frac{\partial L_{Y_i}}{\partial U_{Y_i}} \right| u_{FDAS}(U_{Y_i})$$
(17)

The previous can be completed for individual *shortwave* radiation measurements by multiplying DAS uncertainties by the absolute value of Eq. (7)'s (incoming) or (8)'s (outgoing) partial derivative with respect to the raw voltage measurement:

$$\frac{\partial S_{Y_i}}{\partial P_{Y_i}} = \beta \tag{18}$$

$$u_{FDAS_{P_{g_i}}}(S_{Y_i}) = \left|\frac{\partial S_{Y_i}}{\partial P_{Y_i}}\right| u_{FDAS}(P_{Y_i})$$
(19)

Similarly, this can be calculated for the individual body temperature measurements. In the event that  $R_{T_i} < 100 \ [\Omega]$ , the partial derivative of Eq. (2) with respect to the raw resistance measurement is computed:

## CASE 1:

$$\frac{\partial T_i}{\partial R_{T_i}} = \frac{D_1 (R_0 - 1)^3 + R_{T_i} \left( 2D_2 (R_0 - 1)^2 + R_{T_i} \left( 3D_3 (R_0 - 1) + 4D_4 R_{T_i} \right) \right)}{(R_0 - 1)^4}$$
(20)



If  $R_{T_i} \ge 100 \ [\Omega]$ , the partial derivative of Eq. (3) with respect to the raw resistance measurement is computed:

CASE 2:

$$\frac{\partial T_i}{\partial R_{T_i}} = \frac{1}{R_0 \left(A^2 - 4B(1 - \frac{R_{T_i}}{R_0})\right)^{\frac{1}{2}}}$$
(21)

And the absolute value of the appropriate resulting value is then multiplied by the uncertainty due to DAS noise:

$$u_{FDAS_{R_{T_i}}}(T_i) = \left| \frac{\partial T_i}{\partial R_{T_i}} \right| u_{FDAS}(R_{T_i})$$
(22)

## 6.1.1.3 Body Temperature

To account for the long wave radiation emitted by the pyrgeometer, the body temperature of the pyrgeometer is calculated (Hukseflux 2007). Since the NR01's PRT is internal, it will not be directly calibrated by CVAL (as noted in Section 6.1.1), however, the combined, calibration uncertainty of the incoming and outgoing long wave radiation comprises this uncertainty. Because of this, the only quantifiable uncertainty relating to the body temperature that propagates is that introduced by the DAS.

## 6.1.1.4 Heater

It is assumed that any heater-induced temperature changes in the sensor will be in equilibrium with the PRT. Therefore, any measurement uncertainty induced by the heater should in theory be accounted for by the body temperature of the sensor.

## 6.1.1.5 Longwave radiation

The combined uncertainty for individual longwave radiation measurements can be computed with the aid of the following equations:

$$\frac{\partial L_{Y_i}}{\partial T_i} = 4\alpha_2 \sigma_{SB} (T_i + cU_i)^3$$
<sup>(23)</sup>

And,

$$u_{FDAS_{R_{T_i}}}(L_{Y_i}) = \left|\frac{\partial L_{Y_i}}{\partial T_i}\right| u_{FDAS_{R_{T_i}}}(T_i)$$
(24)

© 2015 NEON Inc. All rights reserved. Page **16** of **23** 



## 6.1.1.6 Combined Measurement Uncertainty

The combined, standard, measurement uncertainty for a radiation measurement, given in units of W m<sup>-</sup><sup>2</sup>, is computed by summing the individual uncertainties in quadrature.

Shortwave:

$$u_{c}(S_{Y_{i}}) = \left(u_{CVAL}^{2}\left(S_{Y_{i}}\right) + u_{FDAS}^{2}\left(S_{Y_{i}}\right)\right)^{\frac{1}{2}}$$
(25)

Longwave:

$$u_{c}(L_{Y_{i}}) = \left(u_{A1,Ug}^{2} + u_{FDAS}^{2}(L_{Y_{i}}) + u_{FDAS_{R_{T_{i}}}}^{2}(L_{Y_{i}})\right)^{\frac{1}{2}}$$
(26)

 $u_{A1,Ug}$  = relative uncertainty of respective (incoming / outgoing, subscript 'g') longwave radiation stream; provided by CVAL (AD[10])

Eq. (25) and (26) are direct applications of Eq. (4).

#### 6.1.1.7 Expanded Measurement Uncertainty

The expanded uncertainties are calculated as:

$$U_{95}(X_{Y_i}) = k_{95} * u_c(X_{Y_i})$$
<sup>(27)</sup>

Where,

 $U_{95}(X_{Y_i})$  = respective expanded measurement uncertainty at 95% confidence ( $W m^{-2}$ )

 $k_{95}$  = 2; coverage factor for 95% confidence (unitless)

#### 6.1.2 Uncertainty of L1 Mean Data Product

The following subsections discuss uncertainties associated with temporally averaged, i.e., L1 mean, data products. As stated previously, it is important to note the differences between the *measurement uncertainties* presented in Section 6.1.1 and the uncertainties presented in the following subsections. The uncertainties presented in the following subsections reflect the uncertainty of a time-averaged

© 2015 NEON Inc. All rights reserved. Page **17** of **23** 



mean value, that is, they reflect the uncertainty of a distribution of measurements collected under noncontrolled conditions (i.e., those found in the field), as well as any uncertainties, in the form of *Truth* and *Trueness*, related to the accuracy of the field assembly.

## 6.1.2.1 Repeatability (natural variation)

To quantify the uncertainty attributable to random effects, the distribution of the individual measurements is used. Specifically, the *estimated standard error of the mean (natural variation)* is computed. This value reflects the repeatability of radiation measurements for a specified time period:

$$u_{NAT}(\overline{X_Y}) = \frac{s(X_Y)}{\sqrt{n}}$$
(28)

Where,

$u_{NAT}(\overline{X_Y})$	= natural variation of the respective radiation data product (W $m^{-2}$ )
$s(T_B)$	= experimental standard deviation of individual observations for the defined time period (W $m^{-2}$ )
n	= number of observations made during the averaging period (unitless)

## 6.1.2.2 Calibration

The calibration uncertainties for the respective L1 mean DPs are similar to those described in Section 6.1.1.1. However, these uncertainties,  $u_{A3,Pu}$ ,  $u_{A3,Pd}$ ,  $u_{A3,Uu}$ , and  $u_{A3,Ud}$  do not account for i) individual sensor repeatability, or ii) the variation of sensors' responses over a population (reproducibility). These components of uncertainty (individually) estimate the uncertainty due to the accuracy of the instrumentation in the form of *Truth* and *Trueness*, a quantity which is not captured by the standard error of the mean. Each are provided by CVAL (AD[10]) and stored in the CI data store. The uncertainty will be applied to the *maximum* radiation value observed over the averaging period. The shortwave radiation uncertainties must be converted to measurement units first.

$$u_{CVAL(TT)}(\overline{S_Y}) = u_{A3,Pg} * P_{g_{MAX}}$$
<sup>(29)</sup>

Where, the subscript "MAX" represents the maximum radiation value observed over a set (averaging period) of observations. Mathematically, this can be defined as:

$$MAX = \{i: u_c(X_{Y_i}) = \max[u_c(X_{Y_1}), \dots, u_c(X_{Y_n})]\}.$$
(30)

And,



$u_{CVAL(TT)}(\overline{S_Y})$	= combined, standard, Field DAS truth and trueness uncertainty due to the respective shortwave radiation measurement (W m <sup>-2</sup> )
X <sub>YMAX</sub>	= respective shortwave radiation measurement corresponding to the maximum, combined, standard measurement uncertainty during the averaging period ( $\mu$ mol m <sup>-2</sup> s <sup>-1</sup> )
$u_{A3,Pg}$	= Combined, relative uncertainty (truth and trueness only) of the respective radiation stream (unitless)

**Note**: Uncertainty values of longwave radiation do not need to be converted, as they are provided in W  $m^{-2}$ .

Please refer to AD[11] for further justification regarding evaluation and quantification of this combined uncertainty.

## 6.1.2.3 Field DAS

Since the L1 mean DP is a function of the individual measurements, any measurement bias introduced by the Field DAS will be reflected in the L1 mean data product. Here, the raw measurement that maximizes the combined uncertainty of an individual measurement (Eq. (30)) is used in the calculation of the L1 mean DP uncertainty. Uncertainty components due to random effects, whether a function of the environment or the measurement assembly, are quantified via the natural variation of the mean (see Section 6.1.2.1). For more information regarding the justification of this approach, please see AD[12].

The accuracy of the Field DAS in the form of *Truth* and *Trueness* propagates through to the uncertainty of the mean DP similarly to how the Field DAS uncertainty associated with a raw voltage propagates through to the uncertainty of the measurement attributable to the Field DAS.

$$u_{FDAS(TT)}\left(W_{g_{MAX}}\right) = \left(u_{V3} * W_{g_{MAX}}\right) + O_V$$
(31)

And

$$u_{FDAS(TT)}(\mathbf{R}_{TMAX}) = (u_{R3} * \mathbf{R}_{TMAX}) + O_R$$
(32)

Where:

 $\begin{aligned} u_{FDAS(TT)} \left( W_{g_{MAX}} \right) &= \text{Field DAS } Truth \text{ and } Trueness \text{ uncertainty of } W_{g_{MAX}} \left( \mathsf{V} \right) \\ u_{FDAS(TT)} \left( \mathsf{R}_{T_{MAX}} \right) &= \text{Field DAS } Truth \text{ and } Trueness \text{ uncertainty of } \mathsf{R}_{T_{MAX}} \left( \Omega \right) \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & \\ & & & & \\ & & & & \\ & & & & \\$ 

## Page **19** of **23**



$W_{g_{MAX}}$	= individual, maximum, radiation measurement observed during
R <sub>TMAX</sub>	the averaging period (V) = individual, <i>maximum</i> , body temperature measurement
	observed during the averaging period ( $\Omega$ )
$u_{V3}$	= combined, relative, Field DAS uncertainty for a voltage data
	stream (truth and trueness only) provided by CVAL (unitless)
$u_{R3}$	= combined, relative, Field DAS uncertainty for a resistance data
	stream (truth and trueness only) provided by CVAL (unitless)
$O_V$	= offset imposed by the FDAS for voltage readings provided by
	CVAL (V)

Thus, analogous to Eq. (17), (19), and (22), respectively:

$$u_{FDAS(TT)}_{U_{Y}}(\overline{L_{Y}}) = \left| \frac{\partial L_{Y_{i}}}{\partial U_{Y_{i}}} \right|_{U_{YMAX}} u_{FDAS(TT)}(U_{YMAX})$$
(33)

$$u_{FDAS(TT)}(\overline{S_Y}) = \left| \frac{\partial S_{Y_i}}{\partial P_{Y_i}} \right|_{P_{Y_{MAX}}} u_{FDAS(TT)}(P_{Y_{MAX}})$$
(34)

$$u_{FDAS(TT)}(T_i) = \left| \frac{\partial T_i}{\partial R_{T_i}} \right|_{R_{T_{MAX}}} u_{FDAS(TT)}(R_{T_{MAX}})$$
(35)

Lastly, following Eq. (24):

$$u_{FDAS(TT)_{R_T}}(\overline{L_Y}) = \left| \frac{\partial L_{Y_i}}{\partial T_i} \right| u_{FDAS(TT)}(T_i)$$
(36)

Where,

$$\begin{array}{l} \left. \frac{\partial L_{Y_i}}{\partial U_{Y_i}} \right|_{U_{Y_{MAX}}} & = \text{partial derivative of Eq. (5) or (6) with respect to } U_{Y_i} \text{ evaluated at} \\ & U_{Y_{MAX}} \quad (W \text{ m}^{-2}) \\ & = \text{partial derivative of Eq. (7) or (8) with respect to } P_{Y_i} \text{ evaluated at} \\ & P_{Y_{MAX}} \quad (W \text{ m}^{-2}) \end{array}$$

 $\ensuremath{\mathbb{C}}$  2015 NEON Inc. All rights reserved. Page 20 of 23



$$\frac{\left|\frac{\partial T_{i}}{\partial R_{T_{i}}}\right|_{R_{T_{MAX}}} = \text{partial derivative of Eq. (2) or (3) with respect to R_{T_{i}} evaluated at R_{T_{MAX}}$$
 (K)

#### 6.1.2.4 Combined Uncertainty

The combined uncertainty for the respective L1 mean radiation data product is given in units of W m<sup>-2</sup> and computed by summing the uncertainties from Sections 6.1.2.1 through 6.1.2.3 in quadrature.

#### Shortwave:

$$u_{c}(\overline{S_{y}}) = \left(u_{NAT}^{2}(\overline{S_{y}}) + u_{CVAL(TT)}^{2}(\overline{S_{Y}}) + u_{FDAS(TT)_{U_{Y}}}^{2}(\overline{S_{Y}})\right)^{\frac{1}{2}}$$
(37)

Longwave:

$$u_{c}(\overline{L_{y}}) = \left(u_{NAT}^{2}(\overline{L_{y}}) + u_{A3,Ug}^{2} + u_{FDAS(TT)_{U_{Y}}}^{2}(\overline{L_{Y}}) + u_{FDAS(TT)_{R_{T}}}^{2}(\overline{L_{Y}})\right)^{\frac{1}{2}}$$
(38)

#### 6.1.2.5 Expanded Uncertainty

The expanded uncertainties are calculated as:

$$U_{95}(\overline{X_Y}) = k_{95} * u_c(\overline{X_Y}) \tag{39}$$

Where:

$$U_{95}(\overline{X_Y})$$
 = expanded L1 mean data product uncertainty at 95% confidence (W m<sup>-2</sup>)

 $k_{95}$  = 2; coverage factor for 95% confidence (unitless)

#### 6.2 Uncertainty Budget

The uncertainty budget is a visual aid detailing i) quantifiable sources of uncertainty, ii) means by which they are derived, and iii) the order of their propagation. Uncertainties denoted in this budget are either derived within this document or will be provided by other NEON teams (e.g., CVAL) and stored in the CI data store.



Source of measurement uncertainty	measurement uncertainty component $u(x_i)$	measurement uncertainty value (W m <sup>-2</sup> )	$\frac{\partial f}{\partial x_i}$	$u_{x_i}(Y) \equiv \left  \frac{\partial f}{\partial x_i} \right  u(x_i)$ (W m <sup>-2</sup> )
SW radiation	$u_c(S_{Y_i})$	Eq. (25)	n/a	n/a
Sensor/calibration	$u_{CVAL}\left(S_{y_{i}}\right)$	Eq. (13)	1	Eq. (13)
FDAS (voltage)	$u_{FDAS}(P_{g_i})$	Eq. (14) (V)	Eq. (18)	Eq. (19)
LW radiation	$u_c(L_{Y_i})$	Eq. (26)	n/a	n/a
Sensor/calibration	$u_{A1,Ug}$	AD[10]	1	AD[10]
FDAS (voltage)	$u_{FDAS}(U_{g_i})$	Eq. (22) (V)	Eq. (23)	Eq. (24)
Body temperature	$u_{FDAS_{R_{T_i}}}(T_i)$	Eq. (22) (K)	Eq. (23)	Eq. (24)
			Eq. (20) OR	
FDAS (resistance)	$u_{FDAS}(\mathbf{R}_{T_i})$	Eq. (15) (Ω)	(21)	Eq. (22) (K)

 Table 6-1: Uncertainty budget for individual radiation measurements. Shaded rows denote the order of uncertainty propagation (from lightest to darkest).

Table 6-2: Uncertainty budget for L1 mean radiation DPs. Shaded rows denote the order of uncertainty propagation (from lightest to darkest).

Source of uncertainty	uncertainty component $u(x_i)$	uncertainty value (W m <sup>-2</sup> )	$\frac{\partial f}{\partial x_i}$	$u_{u_{x_i}}(Y) \equiv \left  \frac{\partial f}{\partial x_i} \right  u(x_i)$ (W m <sup>-2</sup> )
SW radiation	$u_c(\overline{S_Y})$	Eq. (37)	n/a	n/a
Natural variation	$u_{NAT}(\overline{S_Y})$	Eq. (28)	1	Eq. (28)
Sensor/calibration	$u_{CVAL(TT)}(\overline{S_Y})$	Eq. (29)	1	Eq. (29)
FDAS (Voltage)	$u_{FDAS(TT)}(P_g)$	Eq. (31) (V)	Eq. (18)	Eq. (34)
LW radiation	$u_c(\overline{L_Y})$	Eq. (38)	n/a	n/a
Natural variation	$u_{NAT}(\overline{L_Y})$	Eq. (28)	1	Eq. (28)
Sensor/calibration	$u_{A3,Ug}$	AD[10]	1	AD[10]
FDAS (Voltage)	$u_{FDAS(TT)}(U_g)$	Eq. (31) (V)	Eq. (16)	Eq. (33)
Sensor body	$u_{FDAS(TT)}(T_i)$	Eq. (35) (K)	Eq. (23)	Eq. (36)
			Eq. (20) OR	
FDAS (resistance)	$u_{FDAS(TT)}(T_i)$	Eq. (32) (Ω)	(21)	Eq. (35) (K)

© 2015 NEON Inc. All rights reserved.



## 7 FUTURE PLANS AND MODIFICATIONS

Details concerning the evaluation and quantification of Sensor and Field DAS drift will be added to the uncertainty section.

QA/QC tests may be expanded to include consistency analyses among similar measurement streams.

#### 8 BIBLIOGRAPHY

- ASTM E1137 (2004) Standard Specification for Industrial Platinum Resistance Thermometers. pp. 7. ASTM International, West Conshohocken, PA, USA. DOI: 10.1520/E1137\_E1137M-04
- Campbell Scientific (2008) NR01 four-component net radiation sensor instruction manual. pp. 40. Campbell Scientific, Logan, Utah, USA.
- Fu, Q. (2003). Encyclopedia of atmospheric sciences: radiation (solar) (eds J. R. Holton, J. Pyle, & J. A. Curry), pp. 1859-1863. Academic Press, London. ISBN-10: 0122270908
- Goody, R.M. & Yung, Y. L. (1995) Atmospheric radiation: theoretical basis. 2<sup>nd</sup> Ed. pp. 544. Oxford University Press, Oxford, UK ISBN-10: 0195102916
- Hukseflux (2007) NR01 RA01 manual version 0715. pp. 40. Hukseflux Thermal Sensors, Netherlands
- Joint Committee for Guides in Metrology (JCGM) (2008) Evaluation of measurement data Guide to the expression of uncertainty in measurement. pp. 120.
- Joint Committee for Guides in Metrology (JCGM) (2012) International vocabulary of metrology Basic and general concepts and associated terms (VIM). 3<sup>rd</sup> Ed. pp. 92
- National Renewable Energy Laboratory (NREL) (2013) Pyrgeometer Calibration for DOE Atmospheric System Research Program Using NREL Method. [Available online at : <u>http://www.nrel.gov/docs/fy10osti/47756.pdf</u>]
- Taylor, J. R. (1997) An Introduction to Error Analysis: The Study of Uncertainties in Physical Measurements. 2<sup>nd</sup> Ed. pp. 327. University Science Books, Mill Valley, California, USA.